Atlanta Public Schools/ Therrell Cluster

Bunche Middle School

Revised
School Assessment Report

November 10, 2020





Table of Contents

| Sch | ool Executive Summary | 4 |
|-------------|---|----|
| Sch | ool Dashboard Summary | 7 |
| Sch | ool Condition Summary | 8 |
| <u> 197</u> | 9 Bldg 401.1 | 10 |
| | Executive Summary | 10 |
| | Dashboard Summary | 11 |
| | Condition Summary | 12 |
| | Photo Album | 13 |
| | Condition Detail | 14 |
| | System Listing | 15 |
| | System Notes | 17 |
| | Renewal Schedule | 30 |
| | Forecasted Sustainment Requirement | 33 |
| | Condition Index Forecast by Investment Scenario | 34 |
| | Deficiency Summary By System | 35 |
| | Deficiency Summary By Priority | 36 |
| | Deficiency By Priority Investment | 37 |
| | Deficiency Summary By Category | 38 |
| | Deficiency Details By Priority | 39 |
| <u> 201</u> | 4 Bldg 4010 | 40 |
| | Executive Summary | 40 |
| | Dashboard Summary | 41 |
| | Condition Summary | 42 |
| | Photo Album | 43 |
| | Condition Detail | 44 |
| | System Listing | 45 |
| | System Notes | 47 |
| | Renewal Schedule | 61 |
| | Forecasted Sustainment Requirement | 64 |
| | | |

School Assessment Report

| | Condition Index Forecast by Investment Scenario | 65 |
|-------------|---|----|
| | Deficiency Summary By System | 66 |
| | Deficiency Summary By Priority | 67 |
| | Deficiency By Priority Investment | 68 |
| | Deficiency Summary By Category | 69 |
| | Deficiency Details By Priority | 70 |
| <u>Site</u> | | 71 |
| Е | Executive Summary | 71 |
| | Dashboard Summary | 72 |
| | Condition Summary | 73 |
| P | Photo Album | 74 |
| C | Condition Detail | 75 |
| | System Listing | 76 |
| | System Notes | 77 |
| | Renewal Schedule | 82 |
| | Forecasted Sustainment Requirement | 83 |
| | Condition Index Forecast by Investment Scenario | 84 |
| | Deficiency Summary By System | 85 |
| | Deficiency Summary By Priority | 86 |
| | Deficiency By Priority Investment | 87 |
| | Deficiency Summary By Category | 88 |
| | Deficiency Details By Priority | 89 |
| G | Glossary | 90 |

School Executive Summary

The condition of a Campus is the accumulation of the condition evaluations of the component buildings and the site. Building condition is evaluated based on the functional systems and elements of a building and organized according to the **UNIFORMAT II Elemental Classification**. eCOMET uses parametric estimating methodology whereby historical costs for systems, components and equipment are collected by entities such as RSMeans and converted to unit costs, typically \$/SF, and used to approximate future construction costs or replacement values. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The Current Replacement Value (CRV) is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude softcost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

| Gross Area (SF): | 147,385 |
|--------------------|--------------|
| Year Built: | 1979 |
| Last Renovation: | 2014 |
| Replacement Value: | \$31,020,893 |
| Repair Cost: | \$63,199.00 |
| Total FCI: | 0.20 % |
| Total RSLI: | 75.78 % |
| FCA Score: | 99.80 |



Description:

Bunche Middle School is located 1925 Niskey Lake Road, SW in Atlanta, Georgia. The two story, 147,385 square foot building was originally constructed in 1979 with a major renovation completed in 2014. An addition to the main building was constructed in 2014.

This report contains condition and adequacy data collected during the 2019 Facility Condition Assessment (FCA) Update. Detailed condition and deficiency statements are contained in this report for the site and building elements.

A. SUBSTRUCTURE

The building rests on slab-on grade and is assumed to have standard cast-in-place concrete foundations. The building does not have a basement.

B. SUPERSTRUCTURE

Floor construction is metal pan deck with lightweight fill. Roof construction is metal pan deck with lightweight fill. The exterior envelope is composed of walls of brick veneer over CMU. Exterior windows are aluminum frame with operable panes. Exterior doors

School Assessment Report - Bunche Middle School

are hollow metal steel mostly with glazing. Roofing is typically low slope built-up. Roof openings a roof hatch with fixed ladder access. Most building entrances appear to comply with ADA requirements.

C. INTERIORS

Interior partitions are typically CMU. Interior doors are generally solid core wood with hollow metal frames and mostly with glazing. Interior fittings include the following items: white boards, graphics and identifying devices, lockers, toilet accessories, storage shelving, handrails, fabricated toilet partitions. The interior wall finishes are typically painted CMU. Floor finishes in common areas are typically vinyl composition tile. Floor finishes in assignable spaces is typically vinyl composition tile., carpet, and ceramic tile. Ceiling finishes in common areas are typically suspended acoustical tile. Ceiling finishes in assignable areas are typically suspended acoustical tile.

D. SERVICES

CONVEYING: The building does include conveying equipment. Conveying equipment includes one hydraulic elevator, and no wheelchair lifts.

PLUMBING: Plumbing fixtures are typically low-flow water fixtures with manual control valves. Domestic water distribution is combination of copper and galvanized steel with electric hot water heating. Sanitary waste system is cast iron. Rainwater drainage system is internal with roof drains.

HVAC: Heating is provided by gas fired boilers. Cooling is supplied by water cooled chillers. The heating/cooling distribution system is a ductwork system utilizing air handling units. Ceiling mounted exhaust fans are installed in bathrooms and other required areas. Controls and instrumentation are digital and are centrally controlled by an energy management system. This building has a remote Building Automation System.

FIRE PROTECTION: The school does have a fire sprinkler system. The building does have a kitchen hood fire suppression system. Fire extinguishers and cabinets are distributed near fire exits and corridors.

ELECTRICAL: The main electrical service is fed from a pad mounted transformer to the main switchboard/distribution panel located in the building. Lighting is lay-in type, fluorescent light fixtures. Branch circuit wiring is typically copper serving electrical switches and receptacles. Emergency and life safety egress lighting systems are installed and exit signs are present at exit doors and near stairways and are typically illuminated.

COMMUNICATIONS AND SECURITY: The fire alarm system consists of audible/visual strobe annunciators in all common spaces. The system is activated by manual pull stations and smoke detectors and the system is centrally monitored. The telephone and data systems are segregated and include dedicated equipment closets. This building does have a local area network (LAN). The building includes an internal security system that is actuated by the following items: contacts, infrared, optical or a combination of all devices. The building has controlled entry doors access provided by card readers; entry doors are secured with magnetic door locks. The security system has CCTV cameras and is centrally monitored; this building has a public address and paging system combined with the telephone system.

OTHER ELECTRICAL SYSTEMS: This school does have a separately derived emergency power system. There is a natural gas emergency generator.

E. EQUIPMENT & FURNISHINGS

This school includes the following items and equipment: fixed food service, library equipment, fixed casework, window treatment, floor grilles and mats, and multiple seating furnishings.

G.SITE

Campus site features include paved driveways and parking lots, pedestrian pavement, flagpole, covered walkway, landscaping, track and fencing. Site mechanical and electrical features include water, sewer, natural gas and site lighting.

CODE REVIEW

ACCESSIBILITY: The school is generally in compliance with applicable ADA requirements with respect to path of travel, interior and exterior doors, interior signage, and toilet room dimensions, fixtures, and fittings. Most building entrances appear to comply with ADA requirements.

LIFE-SAFETY SYSTEMS: The school is not covered with a wet sprinkler system. Fire extinguishers are located throughout the building. Power outlets in wet areas are GFIC protected. The fire alarm system includes detection devices, audio/visual alarms, and pull stations. Emergency/egress lighting is a combination of battery and special circuit systems. Illuminated exit signage is present in corridors and at exit doors. There is no fall protection at the roof.

Attributes:

| Conoral | Attributes: |
|----------|--------------|
| uenei ai | ALLI IDULES. |

Arch Condition Jejuan Hall MEP Condition Assessor: Homero Guerrero

Assessor:

School Grades: 06, 07, 08 DOE Drawing Total GSF: 147009

DOE Facility Number: 0180 Total # of 0

Modular/Portables:

DOE Interior Site SF: 147385 Total GSF of 0

Modular/Portables:

Approx. Acres: 42.3 Status: Active


School Dashboard Summary


Gross Area: 147,385


 Year Built:
 1979
 Last Renovation:
 2014

 Repair Cost:
 \$63,199
 Replacement Value:
 \$31,020,893

 FCI:
 0.20 %
 RSLI%:
 75.78 %

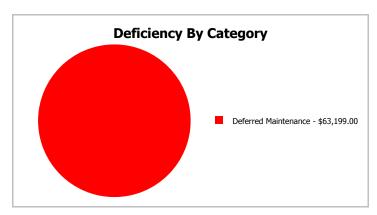

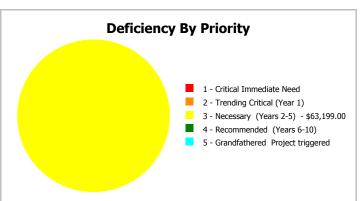

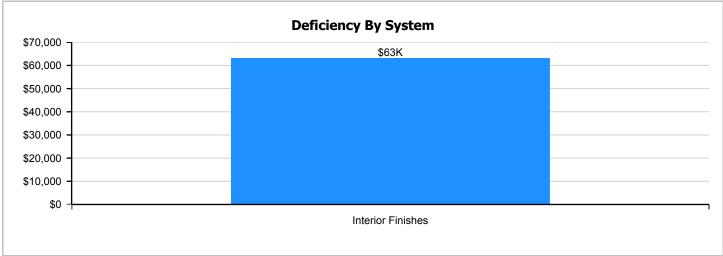



School Condition Summary

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT II classification Level 2. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


Current Investment Requirement and Condition by Uniformat Classification

| UNIFORMAT Classification | RSLI% | FCI % | Current Repair |
|---------------------------------|---------|--------|-----------------------|
| A10 - Foundations | 74.55 % | 0.00 % | \$0.00 |
| B10 - Superstructure | 67.80 % | 0.00 % | \$0.00 |
| B20 - Exterior Enclosure | 78.03 % | 0.00 % | \$0.00 |
| B30 - Roofing | 80.18 % | 0.00 % | \$0.00 |
| C10 - Interior Construction | 78.63 % | 0.00 % | \$0.00 |
| C20 - Stairs | 95.00 % | 0.00 % | \$0.00 |
| C30 - Interior Finishes | 68.98 % | 2.59 % | \$63,199.00 |
| D10 - Conveying | 75.00 % | 0.00 % | \$0.00 |
| D20 - Plumbing | 77.23 % | 0.00 % | \$0.00 |
| D30 - HVAC | 72.71 % | 0.00 % | \$0.00 |
| D40 - Fire Protection | 81.06 % | 0.00 % | \$0.00 |
| D50 - Electrical | 75.68 % | 0.00 % | \$0.00 |
| E10 - Equipment | 75.00 % | 0.00 % | \$0.00 |
| E20 - Furnishings | 75.00 % | 0.00 % | \$0.00 |
| G20 - Site Improvements | 79.11 % | 0.00 % | \$0.00 |
| G30 - Site Mechanical Utilities | 90.00 % | 0.00 % | \$0.00 |
| G40 - Site Electrical Utilities | 83.33 % | 0.00 % | \$0.00 |
| Totals: | 75.78 % | 0.20 % | \$63,199.00 |

Condition Deficiency Priority

| Facility Name | Gross Area (S.F.) | FCI % | 1 - Critical Immediate Need | 2 - Trending Critical (Year 1) | 3 - Necessary (Years 2-5) | 4 - Recommended (Years 6-10) | 5 - Grandfathered Project triggered |
|-----------------|-------------------------|----------|-----------------------------------|--------------------------------------|------------------------------|------------------------------------|--|
| 1979 Bldg 401.1 | 86,114 | 0.11 | \$0.00 | \$0.00 | \$17,362.00 | \$0.00 | \$0.00 |
| 2014 Bldg 4010 | 61,271 | 0.46 | \$0.00 | \$0.00 | \$45,837.00 | \$0.00 | \$0.00 |
| Site | 147,385 | 0.00 | \$0.00 | \$0.00 | \$0.00 | \$0.00 | \$0.00 |
| Total: | | 0.20 | \$0.00 | \$0.00 | \$63,199.00 | \$0.00 | \$0.00 |

Deficiencies By Priority

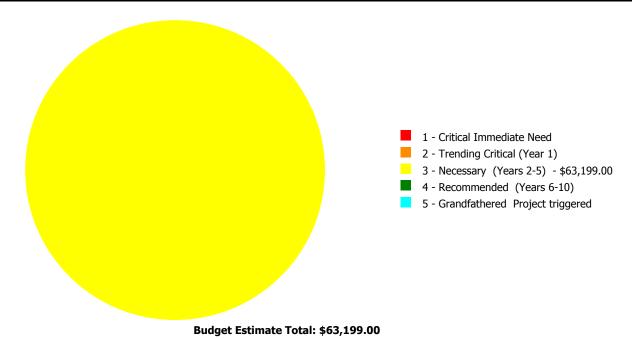

Executive Summary

The condition of a Campus is the accumulation of the condition evaluations of the component buildings and the site. Building condition is evaluated based on the functional systems and elements of a building and organized according to the **UNIFORMAT II Elemental Classification**. eCOMET uses parametric estimating methodology whereby historical costs for systems, components and equipment are collected by entities such as RSMeans and converted to unit costs, typically \$/SF, and used to approximate future construction costs or replacement values. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The Current Replacement Value (CRV) is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude softcost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

| Function: | Middle |
|--------------------|--------------|
| Gross Area (SF): | 86,114 |
| Year Built: | 1979 |
| Last Renovation: | 2014 |
| Replacement Value: | \$15,141,221 |
| Repair Cost: | \$17,362.00 |
| Total FCI: | 0.11 % |
| Total RSLI: | 70.30 % |
| FCA Score: | 99.89 |




Description:


The narrative for this building is included in the Executive Summary Description at the front of this report.


Attributes: This asset has no attributes.


Dashboard Summary

Middle Gross Area: 86,114 Function: 1979 Last Renovation: 2014 Year Built: Repair Cost: \$17,362 Replacement Value: \$15,141,221 0.11 % RSLI%: 70.30 % FCI:

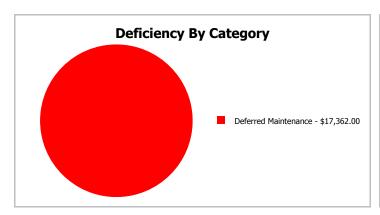

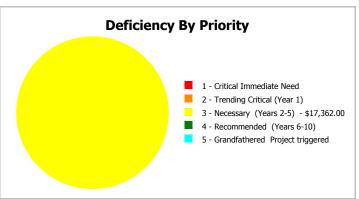

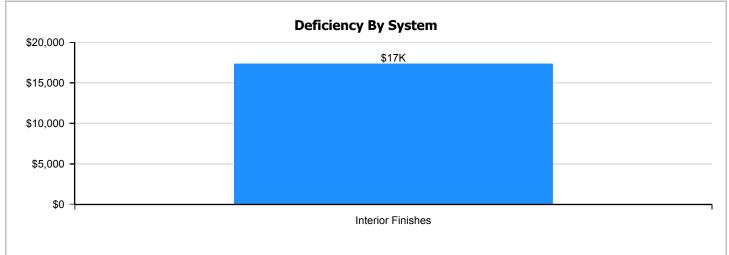

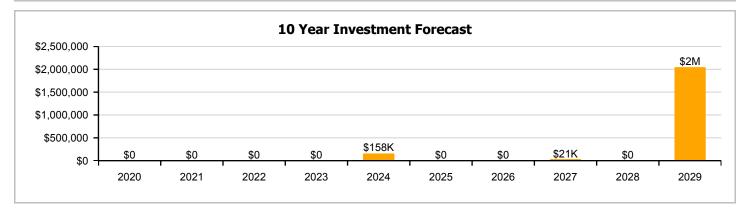

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT II classification Level 2. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

| UNIFORMAT Classification | RSLI % | FCI % | Current Repair Cost |
|-----------------------------|---------|--------|------------------------|
| A10 - Foundations | 60.00 % | 0.00 % | \$0.00 |
| B10 - Superstructure | 60.00 % | 0.00 % | \$0.00 |
| B20 - Exterior Enclosure | 69.25 % | 0.00 % | \$0.00 |
| B30 - Roofing | 80.18 % | 0.00 % | \$0.00 |
| C10 - Interior Construction | 71.80 % | 0.00 % | \$0.00 |
| C20 - Stairs | 95.00 % | 0.00 % | \$0.00 |
| C30 - Interior Finishes | 70.28 % | 1.23 % | \$17,362.00 |
| D10 - Conveying | 75.00 % | 0.00 % | \$0.00 |
| D20 - Plumbing | 77.23 % | 0.00 % | \$0.00 |
| D30 - HVAC | 72.71 % | 0.00 % | \$0.00 |
| D40 - Fire Protection | 81.06 % | 0.00 % | \$0.00 |
| D50 - Electrical | 75.65 % | 0.00 % | \$0.00 |
| E10 - Equipment | 75.00 % | 0.00 % | \$0.00 |
| E20 - Furnishings | 75.00 % | 0.00 % | \$0.00 |
| Totals: | 70.30 % | 0.11 % | \$17,362.00 |

Photo Album

The photo album consists of the various cardinal compass directions of the building.













Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment)
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system as new construction.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

| System | | | | | | Year | Calc Next Renewal | Next Renewal | | | | | | Replacement |
|----------|----------------------------------|---------------|------|--------|------|-----------|-------------------------|-----------------|---------|----------|-----|-----|---------------|-------------|
| Code | System Description | Unit Price \$ | UoM | Qty | Life | Installed | | Year | RSLI% | FCI% | RSL | eCR | Deficiency \$ | Value \$ |
| A1010 | Standard Foundations | \$6.30 | S.F. | 86,114 | 100 | 1979 | 2079 | | 60.00 % | 0.00 % | 60 | | | \$542,518 |
| A1030 | Slab on Grade | \$6.43 | S.F. | 86,114 | 100 | 1979 | 2079 | | 60.00 % | 0.00 % | 60 | | | \$553,713 |
| B1010 | Floor Construction | \$18.19 | S.F. | 86,114 | 100 | 1979 | 2079 | | 60.00 % | 0.00 % | 60 | | | \$1,566,414 |
| B1020 | Roof Construction | \$12.29 | S.F. | 86,114 | 100 | 1979 | 2079 | | 60.00 % | 0.00 % | 60 | | | \$1,058,341 |
| B2010 | Exterior Walls | \$14.43 | S.F. | 86,114 | 100 | 1979 | 2079 | | 60.00 % | 0.00 % | 60 | | | \$1,242,625 |
| B2020 | Exterior Windows | \$8.64 | S.F. | 86,114 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$744,025 |
| B2030 | Exterior Doors | \$0.83 | S.F. | 86,114 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$71,475 |
| B3010105 | Built-Up | \$7.15 | S.F. | 42,000 | 25 | 2014 | 2039 | | 80.00 % | 0.00 % | 20 | | | \$300,300 |
| B3020 | Roof Openings | \$0.41 | S.F. | 42,000 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$17,220 |
| C1010 | Partitions | \$5.58 | S.F. | 86,114 | 100 | 1979 | 2079 | | 60.00 % | 0.00 % | 60 | | | \$480,516 |
| C1020 | Interior Doors | \$3.65 | S.F. | 86,114 | 40 | 2014 | 2054 | | 87.50 % | 0.00 % | 35 | | | \$314,316 |
| C1030 | Fittings | \$2.65 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$228,202 |
| C2010 | Stair Construction | \$2.83 | S.F. | 86,114 | 100 | 2014 | 2114 | | 95.00 % | 0.00 % | 95 | | | \$243,703 |
| C3010220 | Tile | \$9.25 | S.F. | 2,000 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$18,500 |
| C3010230 | Paint & Covering | \$1.47 | S.F. | 84,114 | 10 | 2014 | 2024 | | 50.00 % | 0.00 % | 5 | | | \$123,648 |
| C3020405 | Ероху | \$17.30 | S.F. | 10,000 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$173,000 |
| C3020420 | Ceramic Tile | \$16.74 | S.F. | 2,000 | 50 | 2014 | 2064 | | 90.00 % | 0.00 % | 45 | | | \$33,480 |
| C3020901 | Carpet | \$7.50 | S.F. | 2,000 | 8 | 2014 | 2022 | 2019 | 0.00 % | 110.00 % | 0 | | \$16,500.00 | \$15,000 |
| C3020903 | VCT | \$3.48 | S.F. | 69,000 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$240,120 |
| C3020999 | Other - Concrete Finish w/Sealer | \$6.87 | S.F. | 114 | 10 | 2014 | 2024 | 2019 | 0.00 % | 110.09 % | 0 | | \$862.00 | \$783 |
| C3020999 | Other - Wood | \$13.79 | S.F. | 2,000 | 50 | 2014 | 2064 | | 90.00 % | 0.00 % | 45 | | | \$27,580 |
| C3030 | Ceiling Finishes | \$9.02 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$776,748 |
| D1010 | Elevators and Lifts | \$1.25 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$107,643 |
| D2010 | Plumbing Fixtures | \$6.44 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$554,574 |
| D2020 | Domestic Water Distribution | \$0.75 | S.F. | 86,114 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$64,586 |
| D2030 | Sanitary Waste | \$1.76 | S.F. | 86,114 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$151,561 |
| D2040 | Rain Water Drainage | \$0.41 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$35,307 |
| D3010 | Energy Supply | \$0.61 | S.F. | 86,114 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$52,530 |
| D3020 | Heat Generating Systems | \$3.65 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$314,316 |
| D3030 | Cooling Generating Systems | \$6.16 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$530,462 |
| D3040 | Distribution Systems | \$10.79 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$929,170 |
| D3050 | Terminal & Package Units | \$6.65 | S.F. | 86,114 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$572,658 |

School Assessment Report - 1979 Bldg 401.1

| System Code | System Description | Unit Price \$ | UoM | Qty | Life | Year Installed | | Next Renewal Year | RSLI% | FCI% | RSL | eCR | Deficiency \$ | Replacement Value \$ |
|----------------|---------------------------------|---------------|------|--------|------|-------------------|------|-------------------------|---------|--------|-----|-----|---------------|-------------------------|
| D3060 | Controls & Instrumentation | \$2.25 | S.F. | 86,114 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$193,757 |
| D4010 | Sprinklers | \$4.15 | S.F. | 86,114 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$357,373 |
| D4020 | Standpipes | \$0.34 | S.F. | 86,114 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$29,279 |
| D4030 | Fire Protection Specialties | \$0.10 | S.F. | 86,114 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$8,611 |
| D4090 | Other Fire Protection Systems | \$0.61 | S.F. | 86,114 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$52,530 |
| D5010 | Electrical Service/Distribution | \$2.37 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$204,090 |
| D5020 | Branch Wiring | \$4.86 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$418,514 |
| D5020 | Lighting | \$7.28 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$626,910 |
| D5030810 | Security & Detection Systems | \$1.51 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$130,032 |
| D5030910 | Fire Alarm Systems | \$2.74 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$235,952 |
| D5030920 | Data Communication | \$3.56 | S.F. | 86,114 | 25 | 2014 | 2039 | | 80.00 % | 0.00 % | 20 | | | \$306,566 |
| D5090 | Other Electrical Systems | \$0.36 | S.F. | 86,114 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$31,001 |
| E1020 | Institutional Equipment | \$2.25 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$193,757 |
| E1090 | Other Equipment | \$0.78 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$67,169 |
| E2010 | Fixed Furnishings | \$2.33 | S.F. | 86,114 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$200,646 |
| _ | | | | | | | • | Total | 70.30 % | 0.11 % | | | \$17,362.00 | \$15,141,221 |

System Notes

The facility description in the executive summary contains an overview of each system. The system notes listed below provide additional information on select systems found within the facility.

System: B2010 - Exterior Walls







Note:

System: B2020 - Exterior Windows







Note:

System: B2030 - Exterior Doors







Note:

System: B3010105 - Built-Up







Note:

System: B3020 - Roof Openings







Note:

System: C1010 - Partitions







Note:

System: C1020 - Interior Doors







System: C1030 - Fittings








Note:

System: C2010 - Stair Construction



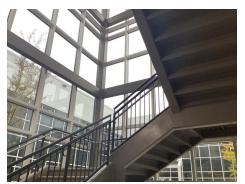



System: C3010220 - Tile





Note:

System: C3010230 - Paint & Covering







Note:

System: C3020405 - Epoxy







Note:

System: C3020420 - Ceramic Tile





System: C3020901 - Carpet







Note:

System: C3020903 - VCT







Note:

System: C3020999 - Other - Concrete Finish w/Sealer





Note:

System: C3020999 - Other - Wood







Note:

System: C3030 - Ceiling Finishes







Note:

System: D1010 - Elevators and Lifts







System: D2010 - Plumbing Fixtures







Note:

System: D2020 - Domestic Water Distribution







Note:

System: D2030 - Sanitary Waste







System: D2040 - Rain Water Drainage







System: D3010 - Energy Supply



Note:

System: D3020 - Heat Generating Systems







Note:

System: D3030 - Cooling Generating Systems







Note:

System: D3040 - Distribution Systems







Note:

System: D3050 - Terminal & Package Units







Note:

System: D3060 - Controls & Instrumentation








Note:

System: D4010 - Sprinklers



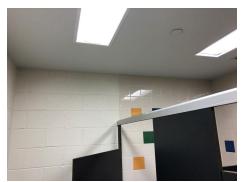



Note:

System: D4020 - Standpipes



Note:

System: D4030 - Fire Protection Specialties







Note:

System: D5020 - Branch Wiring







System: D5020 - Lighting







Note:

System: D5030810 - Security & Detection Systems







Note:

System: D5030910 - Fire Alarm Systems







Note:

System: D5030920 - Data Communication








Note:

System: E1020 - Institutional Equipment

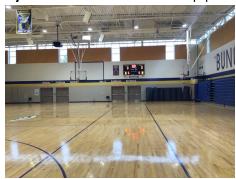





Note:

System: E2010 - Fixed Furnishings







Note:

Renewal Schedule

eCOMET forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the System Listing table. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

| System | Current Deficiencies | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | Total |
|--------------------------------|-------------------------|------|------|------|------|-----------|------|------|----------|------|-------------|-------------|
| Total: | \$17,362 | \$0 | \$0 | \$0 | \$0 | \$157,675 | \$0 | \$0 | \$20,902 | \$0 | \$2,044,902 | \$2,240,841 |
| * A - Substructure | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * A10 - Foundations | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * A1010 - Standard Foundations | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * A1030 - Slab on Grade | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B - Shell | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B10 - Superstructure | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * B1010 - Floor Construction | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * B1020 - Roof Construction | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B20 - Exterior Enclosure | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * B2010 - Exterior Walls | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B2020 - Exterior Windows | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B2030 - Exterior Doors | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B30 - Roofing | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B3010 - Roof Coverings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B3010105 - Built-Up | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B3020 - Roof Openings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C - Interiors | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C10 - Interior Construction | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C1010 - Partitions | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C1020 - Interior Doors | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C1030 - Fittings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C20 - Stairs | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * C2010 - Stair Construction | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C30 - Interior Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C3010 - Wall Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |

| System | Current Deficiencies | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | Total |
|---|-------------------------|------|------|------|------|-----------|------|------|----------|------|-----------|-----------|
| C3010220 - Tile | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C3010230 - Paint & Covering | \$0 | \$0 | \$0 | \$0 | \$0 | \$157,675 | \$0 | \$0 | \$0 | \$0 | \$0 | \$157,675 |
| C3020 - Floor Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C3020405 - Epoxy | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$274,347 | \$274,347 |
| C3020420 - Ceramic Tile | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C3020901 - Carpet | \$16,500 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$20,902 | \$0 | \$0 | \$37,402 |
| C3020903 - VCT | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$500,187 | \$500,187 |
| C3020999 - Other - Concrete Finish w/Sealer | \$862 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$1,157 | \$2,019 |
| C3020999 - Other - Wood | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C3030 - Ceiling Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D - Services | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D10 - Conveying | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D1010 - Elevators and Lifts | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D20 - Plumbing | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2010 - Plumbing Fixtures | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2020 - Domestic Water Distribution | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2030 - Sanitary Waste | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2040 - Rain Water Drainage | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D30 - HVAC | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3010 - Energy Supply | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3020 - Heat Generating Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3030 - Cooling Generating Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3040 - Distribution Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3050 - Terminal & Package Units | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$846,565 | \$846,565 |
| D3060 - Controls & Instrumentation | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$286,432 | \$286,432 |
| D40 - Fire Protection | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D4010 - Sprinklers | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D4020 - Standpipes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D4030 - Fire Protection Specialties | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$12,731 | \$12,731 |
| D4090 - Other Fire Protection Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$77,654 | \$77,654 |
| D50 - Electrical | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5010 - Electrical Service/Distribution | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |


School Assessment Report - 1979 Bldg 401.1

| System | Current Deficiencies | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | Total |
|--|-------------------------|------|------|------|------|------|------|------|------|------|----------|----------|
| D5020 - Branch Wiring | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5020 - Lighting | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5030 - Communications and Security | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5030810 - Security & Detection Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5030910 - Fire Alarm Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5030920 - Data Communication | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5090 - Other Electrical Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$45,829 | \$45,829 |
| E - Equipment & Furnishings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E10 - Equipment | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E1020 - Institutional Equipment | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E1090 - Other Equipment | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E20 - Furnishings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E2010 - Fixed Furnishings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |

^{*} Indicates non-renewable system

Forecasted Capital Renewal Requirement


The following chart shows the current building deficiencies and forecasted capital renewal (sustainment) requirements over the next ten years.

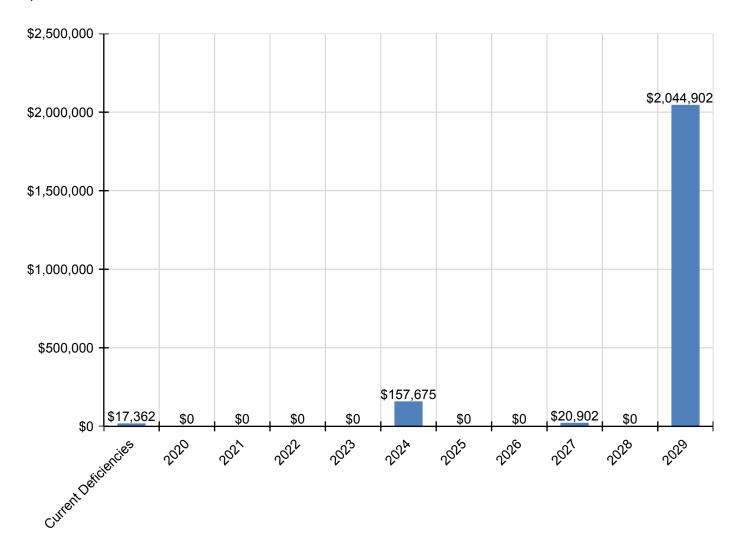

Condition Index Forecast by Investment Scenario

The chart below illustrates the effect of various investment levels on the building FCI for the next 10 years. The levels of investment shown below include:


- Current FCI: a variable investment amount based on renewing expired systems to maintain the current FCI for the building
- 2% Investment: an annual investment of 2% of the replacement value of the building, escalated for inflation
- 4% Investment: an annual investment of 4% of the replacement value of the building, escalated for inflation

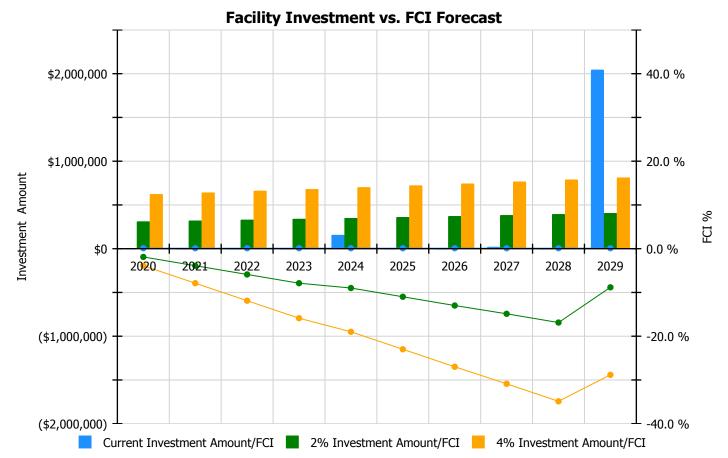

| | Investment Amount | 2% Investm | ent | 4% Investment | | |
|--------|---------------------|----------------|----------|----------------|----------|--|
| Year | Current FCI - 0.11% | Amount | FCI | Amount | FCI | |
| 2020 | \$0 | \$311,909.00 | -1.89 % | \$623,818.00 | -3.89 % | |
| 2021 | \$0 | \$321,266.00 | -3.89 % | \$642,533.00 | -7.89 % | |
| 2022 | \$0 | \$330,904.00 | -5.89 % | \$661,809.00 | -11.89 % | |
| 2023 | \$0 | \$340,832.00 | -7.89 % | \$681,663.00 | -15.89 % | |
| 2024 | \$157,675 | \$351,056.00 | -8.99 % | \$702,113.00 | -18.99 % | |
| 2025 | \$0 | \$361,588.00 | -10.99 % | \$723,176.00 | -22.99 % | |
| 2026 | \$0 | \$372,436.00 | -12.99 % | \$744,872.00 | -26.99 % | |
| 2027 | \$20,902 | \$383,609.00 | -14.88 % | \$767,218.00 | -30.88 % | |
| 2028 | \$0 | \$395,117.00 | -16.88 % | \$790,234.00 | -34.88 % | |
| 2029 | \$2,044,902 | \$406,971.00 | -8.83 % | \$813,941.00 | -28.83 % | |
| Total: | \$2,223,479 | \$3,575,688.00 | | \$7,151,377.00 | | |

Deficiency Summary by System


Current deficiencies included assemblies that have reached or exceeded their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Useful Life'. The following chart lists all current deficiencies associated with this facility.

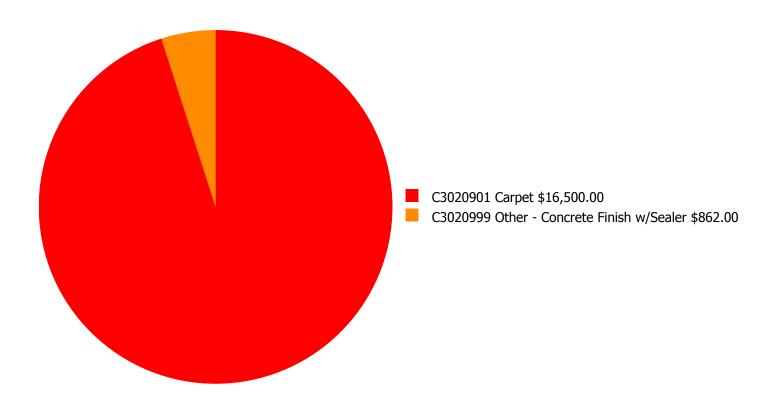

Budget Estimate Total: \$17,362.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

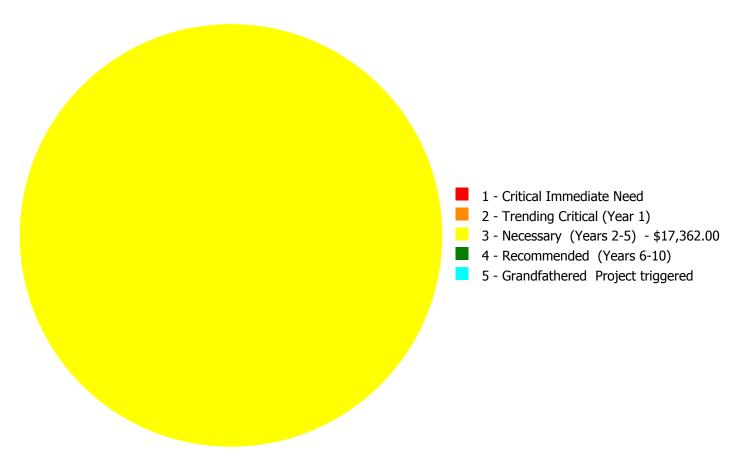

Budget Estimate Total: \$17,362.00


Deficiency By Priority Investment Table

The table below shows the current investment cost grouped by deficiency priority and building system.

| System Code | System Description | 1 - Critical Immediate Need | 2 - Trending Critical (Year 1) | | 4 - Recommended (Years 6-10) | 5 - Grandfathered Project triggered | Total |
|----------------|----------------------------------|-----------------------------------|--------------------------------------|-------------|------------------------------------|--|-------------|
| C3020901 | Carpet | \$0.00 | \$0.00 | \$16,500.00 | \$0.00 | \$0.00 | \$16,500.00 |
| C3020999 | Other - Concrete Finish w/Sealer | \$0.00 | \$0.00 | \$862.00 | \$0.00 | \$0.00 | \$862.00 |
| | Total: | \$0.00 | \$0.00 | \$17,362.00 | \$0.00 | \$0.00 | \$17,362.00 |

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

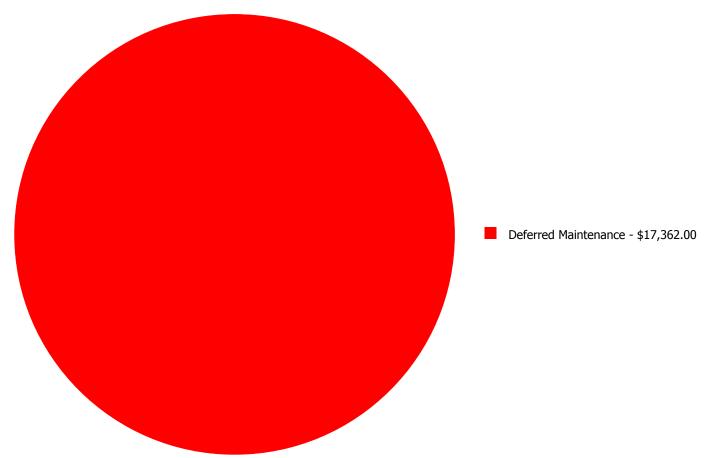

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 - Necessary (Years 2-5):

System: C3020901 - Carpet



Location: 1979 Bldg 401.1
 Distress: Beyond Expected Life
 Category: Deferred Maintenance
 Priority: 3 - Necessary (Years 2-5)

Correction: Renew System

Qty: 2,000.00

Unit of Measure: S.F.

Estimate: \$16,500.00

Assessor Name: Eduardo Lopez **Date Created:** 10/08/2020

Notes:

System: C3020999 - Other - Concrete Finish w/Sealer



Location: 1979 Bldg 401.1

Distress: Beyond Expected Life

Category: Deferred Maintenance

Priority: 3 - Necessary (Years 2-5)

Correction: Renew System

Qty: 114.00

Unit of Measure: S.F.

Estimate: \$862.00

Assessor Name: Eduardo Lopez **Date Created:** 10/08/2020

Executive Summary

The condition of a Campus is the accumulation of the condition evaluations of the component buildings and the site. Building condition is evaluated based on the functional systems and elements of a building and organized according to the **UNIFORMAT II Elemental Classification**. eCOMET uses parametric estimating methodology whereby historical costs for systems, components and equipment are collected by entities such as RSMeans and converted to unit costs, typically \$/SF, and used to approximate future construction costs or replacement values. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The Current Replacement Value (CRV) is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude softcost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

| Function: | Middle |
|--------------------|-------------|
| Gross Area (SF): | 61,271 |
| Year Built: | 2014 |
| Last Renovation: | 2014 |
| Replacement Value: | \$9,894,217 |
| Repair Cost: | \$45,837.00 |
| Total FCI: | 0.46 % |
| Total RSLI: | 81.01 % |
| FCA Score: | 99.54 |
| | |




Description:


The narrative for this building is included in the Executive Summary Description at the front of this report.


Attributes: This asset has no attributes.


Dashboard Summary

Middle Gross Area: 61,271 Function: 2014 Last Renovation: 2014 Year Built: Repair Cost: \$45,837 Replacement Value: \$9,894,217 0.46 % RSLI%: 81.01 % FCI:

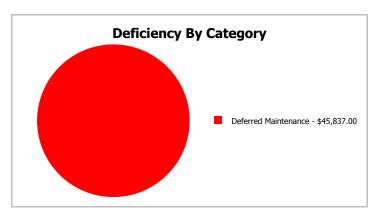

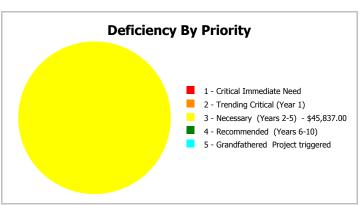

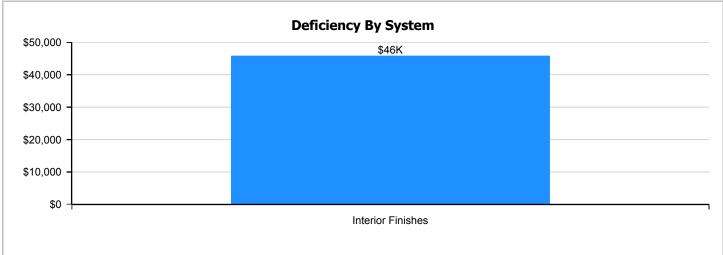

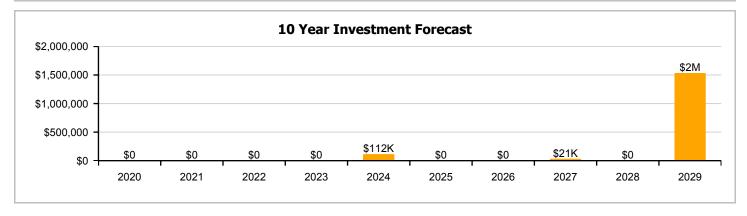

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT II classification Level 2. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

| UNIFORMAT Classification | RSLI % | FCI % | Current Repair Cost |
|-----------------------------|---------|--------|------------------------|
| A10 - Foundations | 95.00 % | 0.00 % | \$0.00 |
| B10 - Superstructure | 95.00 % | 0.00 % | \$0.00 |
| B20 - Exterior Enclosure | 90.38 % | 0.00 % | \$0.00 |
| B30 - Roofing | 80.18 % | 0.00 % | \$0.00 |
| C10 - Interior Construction | 88.23 % | 0.00 % | \$0.00 |
| C20 - Stairs | 95.00 % | 0.00 % | \$0.00 |
| C30 - Interior Finishes | 67.20 % | 4.43 % | \$45,837.00 |
| D10 - Conveying | 75.00 % | 0.00 % | \$0.00 |
| D20 - Plumbing | 77.23 % | 0.00 % | \$0.00 |
| D30 - HVAC | 72.71 % | 0.00 % | \$0.00 |
| D40 - Fire Protection | 81.06 % | 0.00 % | \$0.00 |
| D50 - Electrical | 75.72 % | 0.00 % | \$0.00 |
| E10 - Equipment | 75.00 % | 0.00 % | \$0.00 |
| E20 - Furnishings | 75.00 % | 0.00 % | \$0.00 |
| Totals: | 81.01 % | 0.46 % | \$45,837.00 |

Photo Album

The photo album consists of the various cardinal compass directions of the building.

















Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment)
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system as new construction.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

| System Code | | Hait Brian A | | 21. | 1.6- | Year | Calc Next Renewal | Next Renewal | DCI TO/ | FC70/ | BCI | - CD | Positive made | Replacement Value \$ |
|----------------|---|-------------------------|------------|-------------------|-------------|-------------------|-------------------------|-----------------|---------|----------------|---------------|------|---------------|-------------------------|
| A1010 | System Description Standard Foundations | Unit Price \$ \$6.30 | UoM S E | Qty 61,271 | Life 100 | Installed 2014 | Year 2114 | Year | 95.00 % | FCI% 0.00 % | RSL 95 | eCR | Deficiency \$ | \$386,007 |
| A1010 | Slab on Grade | \$6.43 | | 61,271 | 100 | 2014 | 2114 | | 95.00 % | 0.00 % | 95 | | | \$393,973 |
| B1020 | Roof Construction | \$12.29 | | 61,271 | 100 | 2014 | 2114 | | 95.00 % | 0.00 % | 95 | | | \$753,021 |
| B2010 | Exterior Walls | \$14.43 | | 61,271 | 100 | 2014 | 2114 | | 95.00 % | 0.00 % | 95 | | | \$884,141 |
| B2020 | Exterior Windows | \$8.64 | | 61,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$529,381 |
| B2030 | Exterior Doors | \$0.83 | | 61,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$50,855 |
| B3010105 | Built-Up | \$7.15 | | 30,000 | 25 | 2014 | 2039 | | 80.00 % | 0.00 % | 20 | | | \$214,500 |
| B3020 | Roof Openings | \$0.41 | | 30,000 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$12,300 |
| C1010 | Partitions | \$5.58 | | 61,271 | 100 | 2014 | 2114 | | 95.00 % | 0.00 % | 95 | | | \$341,892 |
| C1020 | Interior Doors | \$3.65 | | 61,271 | 40 | 2014 | 2054 | | 87.50 % | 0.00 % | 35 | | | \$223,639 |
| C1030 | Fittings | \$2.65 | | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$162,368 |
| C2010 | Stair Construction | \$2.83 | S.F. | 61,271 | 100 | 2014 | 2114 | | 95.00 % | 0.00 % | 95 | | | \$173,397 |
| C3010220 | Tile | \$9.25 | S.F. | 1,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$11,757 |
| C3010230 | Paint & Covering | \$1.47 | S.F. | 60,000 | 10 | 2014 | 2024 | | 50.00 % | 0.00 % | 5 | | | \$88,200 |
| C3020405 | Ероху | \$17.30 | S.F. | 10,000 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$173,000 |
| C3020901 | Carpet | \$7.50 | S.F. | 2,000 | 8 | 2014 | 2022 | 2019 | 0.00 % | 110.00 % | 0 | | \$16,500.00 | \$15,000 |
| C3020903 | VCT | \$3.48 | S.F. | 48,271 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$167,983 |
| C3020999 | Other - Rubber or Neoprene | \$26.67 | S.F. | 1,000 | 10 | 2014 | 2024 | 2019 | 0.00 % | 110.00 % | 0 | | \$29,337.00 | \$26,670 |
| C3030 | Ceiling Finishes | \$9.02 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$552,664 |
| D1010 | Elevators and Lifts | \$1.25 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$76,589 |
| D2010 | Plumbing Fixtures | \$6.44 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$394,585 |
| D2020 | Domestic Water Distribution | \$0.75 | S.F. | 61,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$45,953 |
| D2030 | Sanitary Waste | \$1.76 | S.F. | 61,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$107,837 |
| D2040 | Rain Water Drainage | \$0.41 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$25,121 |
| D3010 | Energy Supply | \$0.61 | S.F. | 61,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$37,375 |
| D3020 | Heat Generating Systems | \$3.65 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$223,639 |
| D3030 | Cooling Generating Systems | \$6.16 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$377,429 |
| D3040 | Distribution Systems | \$10.79 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$661,114 |
| D3050 | Terminal & Package Units | \$6.65 | S.F. | 61,271 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$407,452 |
| D3060 | Controls & Instrumentation | \$2.25 | | 61,271 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$137,860 |
| D4010 | Sprinklers | \$4.15 | | 61,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$254,275 |
| D4020 | Standpipes | \$0.34 | S.F. | 61,271 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$20,832 |

| System Code | System Description | Unit Price \$ | UoM | Qty | Life | Year Installed | | Next Renewal Year | RSLI% | FCI% | RSL | eCR | Deficiency \$ | Replacement Value \$ |
|----------------|---------------------------------|---------------|------|--------|------|-------------------|------|-------------------------|---------|--------|-----|-----|---------------|-------------------------|
| D4030 | Fire Protection Specialties | \$0.10 | S.F. | 61,271 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$6,127 |
| D4090 | Other Fire Protection Systems | \$0.61 | S.F. | 61,271 | 15 | 2014 | 2029 | | 66.67 % | 0.00 % | 10 | | | \$37,375 |
| D5010 | Electrical Service/Distribution | \$2.37 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$145,212 |
| D5020 | Branch Wiring | \$4.86 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$297,777 |
| D5020 | Lighting | \$7.28 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$446,053 |
| D5030810 | Security & Detection Systems | \$1.51 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$92,519 |
| D5030910 | Fire Alarm Systems | \$2.74 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$167,883 |
| D5030920 | Data Communication | \$3.56 | S.F. | 61,271 | 25 | 2014 | 2039 | | 80.00 % | 0.00 % | 20 | | | \$218,125 |
| D5090 | Other Electrical Systems | \$143,047.70 | Ea. | 1 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$143,048 |
| E1020 | Institutional Equipment | \$3.57 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$218,737 |
| E1090 | Other Equipment | \$0.78 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$47,791 |
| E2010 | Fixed Furnishings | \$2.33 | S.F. | 61,271 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$142,761 |
| | | | | | | | | Total | 81.01 % | 0.46 % | | | \$45,837.00 | \$9,894,217 |

System Notes

The facility description in the executive summary contains an overview of each system. The system notes listed below provide additional information on select systems found within the facility.

System: B2010 - Exterior Walls







Note:

System: B2020 - Exterior Windows







Note:

System: B2030 - Exterior Doors



System: B3010105 - Built-Up







Note:

System: B3020 - Roof Openings








Note:

System: C1010 - Partitions

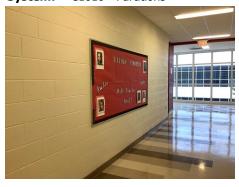





Note:

System: C1020 - Interior Doors







Note:

System: C1030 - Fittings







Note:

System: C2010 - Stair Construction





System: C3010220 - Tile








Note:

System: C3010230 - Paint & Covering



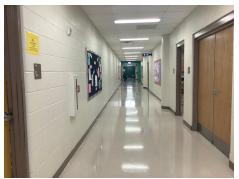



Note:

System: C3020405 - Epoxy







Note:

System: C3020901 - Carpet







Note:

System: C3020903 - VCT








Note:

System: C3020999 - Other - Rubber or Neoprene

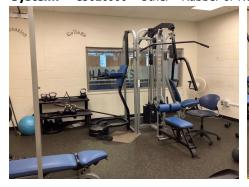



System: C3030 - Ceiling Finishes







Note:

System: D1010 - Elevators and Lifts



Note:

System: D2010 - Plumbing Fixtures







System: D2020 - Domestic Water Distribution







Note:

System: D2030 - Sanitary Waste







Note:

System: D2040 - Rain Water Drainage







Note:

System: D3010 - Energy Supply



Note:

System: D3020 - Heat Generating Systems







Note:

System: D3030 - Cooling Generating Systems







System: D3040 - Distribution Systems







Note:

System: D3050 - Terminal & Package Units







Note:

System: D3060 - Controls & Instrumentation







Note:

System: D4010 - Sprinklers







Note:

System: D4020 - Standpipes





Note:

System: D4030 - Fire Protection Specialties



System: D4090 - Other Fire Protection Systems







Note:

System: D5010 - Electrical Service/Distribution








Note:

System: D5020 - Branch Wiring





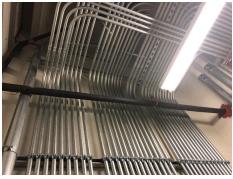

Note:

System: D5020 - Lighting







Note:

System: D5030810 - Security & Detection Systems







Note:

System: D5030910 - Fire Alarm Systems







Note:

System: D5030920 - Data Communication







Note:

System: D5090 - Other Electrical Systems







Note:

System: E1020 - Institutional Equipment







Note:

System: E1090 - Other Equipment







Note:

System: E2010 - Fixed Furnishings







Renewal Schedule

eCOMET forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the System Listing table. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

| System | Current Deficiencies | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | Total |
|--------------------------------|-------------------------|------|------|------|------|-----------|------|------|----------|------|-------------|-------------|
| Total: | \$45,837 | \$0 | \$0 | \$0 | \$0 | \$112,473 | \$0 | \$0 | \$20,902 | \$0 | \$1,534,144 | \$1,713,355 |
| * A - Substructure | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * A10 - Foundations | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * A1010 - Standard Foundations | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * A1030 - Slab on Grade | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B - Shell | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B10 - Superstructure | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * B1020 - Roof Construction | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B20 - Exterior Enclosure | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * B2010 - Exterior Walls | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B2020 - Exterior Windows | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B2030 - Exterior Doors | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B30 - Roofing | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B3010 - Roof Coverings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B3010105 - Built-Up | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| B3020 - Roof Openings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C - Interiors | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C10 - Interior Construction | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C1010 - Partitions | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C1020 - Interior Doors | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C1030 - Fittings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C20 - Stairs | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| * C2010 - Stair Construction | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C30 - Interior Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C3010 - Wall Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| C3010220 - Tile | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |


| System | Current Deficiencies | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | Total |
|---|-------------------------|------|------|------|------|-----------|------|------|----------|------|-----------|-----------|
| C3010230 - Paint & Covering | \$0 | \$0 | \$0 | \$0 | \$0 | \$112,473 | \$0 | \$0 | \$0 | \$0 | \$0 | \$112,473 |
| C3020 - Floor Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| С3020405 - Ероху | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$274,347 | \$274,347 |
| C3020901 - Carpet | \$16,500 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$20,902 | \$0 | \$0 | \$37,402 |
| C3020903 - VCT | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$349,921 | \$349,921 |
| C3020999 - Other - Rubber or Neoprene | \$29,337 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$39,426 | \$68,763 |
| C3030 - Ceiling Finishes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D - Services | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D10 - Conveying | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D1010 - Elevators and Lifts | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D20 - Plumbing | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2010 - Plumbing Fixtures | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2020 - Domestic Water Distribution | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2030 - Sanitary Waste | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D2040 - Rain Water Drainage | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D30 - HVAC | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3010 - Energy Supply | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3020 - Heat Generating Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3030 - Cooling Generating Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3040 - Distribution Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D3050 - Terminal & Package Units | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$602,339 | \$602,339 |
| D3060 - Controls & Instrumentation | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$203,800 | \$203,800 |
| D40 - Fire Protection | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D4010 - Sprinklers | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D4020 - Standpipes | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D4030 - Fire Protection Specialties | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$9,058 | \$9,058 |
| D4090 - Other Fire Protection Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$55,252 | \$55,252 |
| D50 - Electrical | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5010 - Electrical Service/Distribution | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5020 - Branch Wiring | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5020 - Lighting | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5030 - Communications and Security | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |

| System | Current Deficiencies | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | Total |
|--|-------------------------|------|------|------|------|------|------|------|------|------|------|-------|
| D5030810 - Security & Detection Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5030910 - Fire Alarm Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5030920 - Data Communication | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| D5090 - Other Electrical Systems | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E - Equipment & Furnishings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E10 - Equipment | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E1020 - Institutional Equipment | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E1090 - Other Equipment | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E20 - Furnishings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| E2010 - Fixed Furnishings | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |

^{*} Indicates non-renewable system

Forecasted Capital Renewal Requirement


The following chart shows the current building deficiencies and forecasted capital renewal (sustainment) requirements over the next ten years.

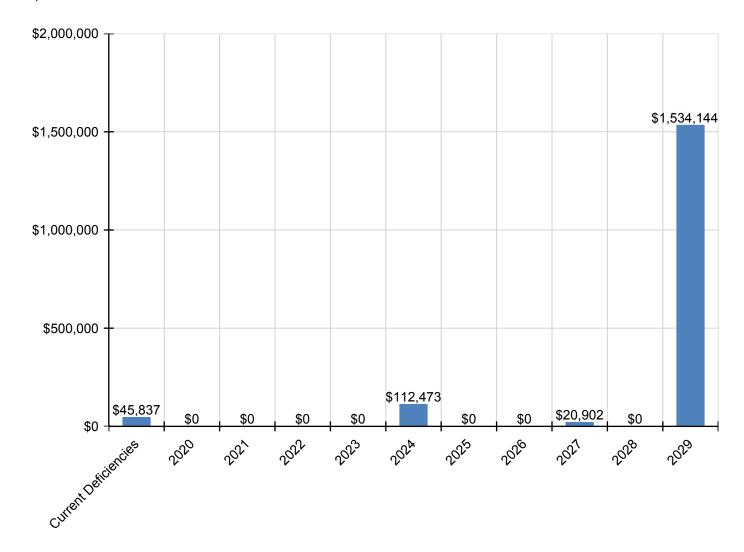

Condition Index Forecast by Investment Scenario

The chart below illustrates the effect of various investment levels on the building FCI for the next 10 years. The levels of investment shown below include:


- Current FCI: a variable investment amount based on renewing expired systems to maintain the current FCI for the building
- 2% Investment: an annual investment of 2% of the replacement value of the building, escalated for inflation
- 4% Investment: an annual investment of 4% of the replacement value of the building, escalated for inflation

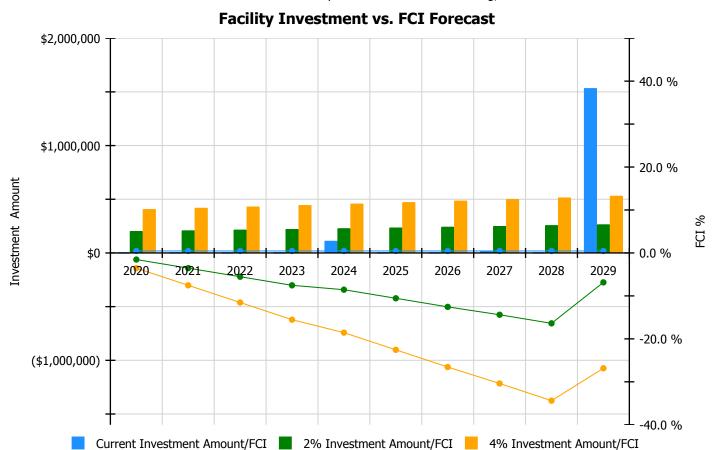

| | Investment Amount | 2% Investm | ent | 4% Investm | ent |
|--------|---------------------|----------------|----------|----------------|----------|
| Year | Current FCI - 0.46% | Amount | FCI | Amount | FCI |
| 2020 | \$0 | \$203,821.00 | -1.54 % | \$407,642.00 | -3.54 % |
| 2021 | \$0 | \$209,935.00 | -3.54 % | \$419,871.00 | -7.54 % |
| 2022 | \$0 | \$216,234.00 | -5.54 % | \$432,467.00 | -11.54 % |
| 2023 | \$0 | \$222,721.00 | -7.54 % | \$445,441.00 | -15.54 % |
| 2024 | \$112,473 | \$229,402.00 | -8.56 % | \$458,804.00 | -18.56 % |
| 2025 | \$0 | \$236,284.00 | -10.56 % | \$472,569.00 | -22.56 % |
| 2026 | \$0 | \$243,373.00 | -12.56 % | \$486,746.00 | -26.56 % |
| 2027 | \$20,902 | \$250,674.00 | -14.39 % | \$501,348.00 | -30.39 % |
| 2028 | \$0 | \$258,194.00 | -16.39 % | \$516,388.00 | -34.39 % |
| 2029 | \$1,534,144 | \$265,940.00 | -6.85 % | \$531,880.00 | -26.85 % |
| Total: | \$1,667,518 | \$2,336,578.00 | | \$4,673,156.00 | |

Deficiency Summary by System


Current deficiencies included assemblies that have reached or exceeded their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Useful Life'. The following chart lists all current deficiencies associated with this facility.

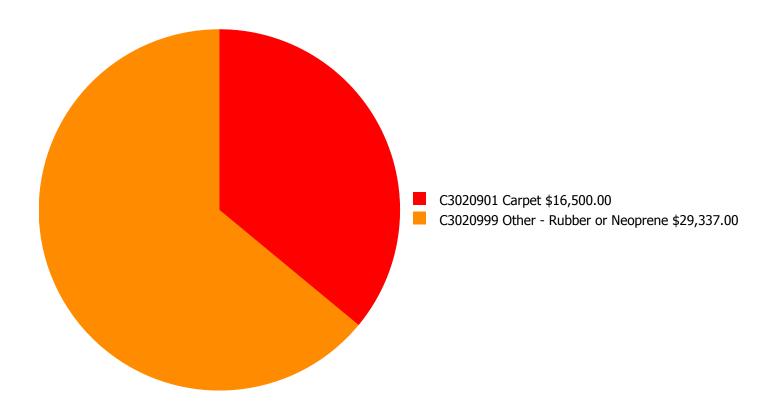

Budget Estimate Total: \$45,837.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

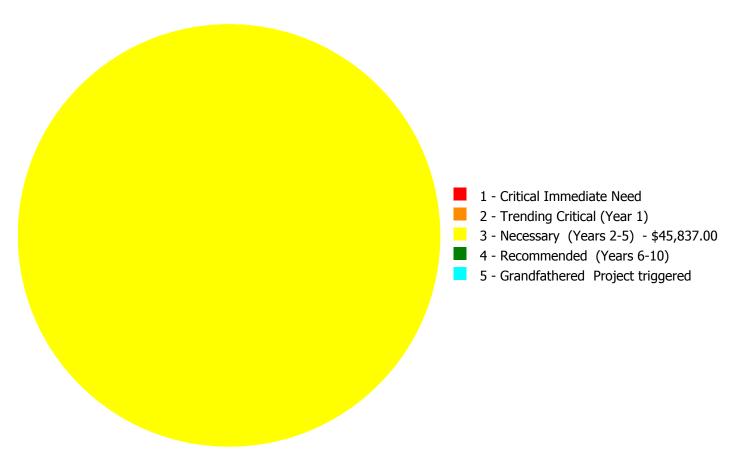

Budget Estimate Total: \$45,837.00


Deficiency By Priority Investment Table

The table below shows the current investment cost grouped by deficiency priority and building system.

| System Code | System Description | 1 - Critical Immediate Need | 2 - Trending Critical (Year 1) | _ | 4 - Recommended (Years 6-10) | 5 - Grandfathered Project triggered | Total |
|----------------|----------------------------|-----------------------------------|--------------------------------------|-------------|------------------------------------|--|-------------|
| C3020901 | Carpet | \$0.00 | \$0.00 | \$16,500.00 | \$0.00 | \$0.00 | \$16,500.00 |
| C3020999 | Other - Rubber or Neoprene | \$0.00 | \$0.00 | \$29,337.00 | \$0.00 | \$0.00 | \$29,337.00 |
| | Total: | \$0.00 | \$0.00 | \$45,837.00 | \$0.00 | \$0.00 | \$45,837.00 |

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

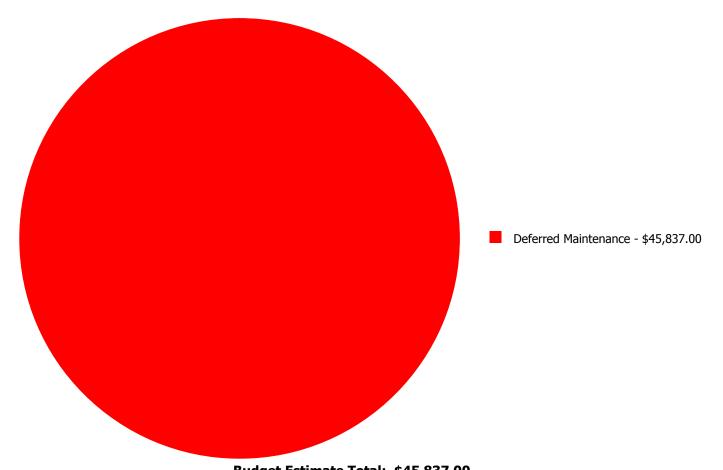

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 - Necessary (Years 2-5):

System: C3020901 - Carpet



Location: 2014 Bldg 4010
 Distress: Beyond Expected Life
 Category: Deferred Maintenance
 Priority: 3 - Necessary (Years 2-5)

Correction: Renew System

Qty: 2,000.00

Unit of Measure: S.F.

Estimate: \$16,500.00

Assessor Name: Eduardo Lopez **Date Created:** 10/08/2020

Notes:

System: C3020999 - Other - Rubber or Neoprene



Location: 2014 Bldg 4010

Distress: Beyond Expected Life

Category: Deferred Maintenance

Priority: 3 - Necessary (Years 2-5)

Correction: Renew System

Qty: 1,000.00

Unit of Measure: S.F.

Estimate: \$29,337.00 **Assessor Name:** Eduardo Lopez **Date Created:** 10/08/2020

Executive Summary

The condition of a Campus is the accumulation of the condition evaluations of the component buildings and the site. Building condition is evaluated based on the functional systems and elements of a building and organized according to the **UNIFORMAT II Elemental Classification**. eCOMET uses parametric estimating methodology whereby historical costs for systems, components and equipment are collected by entities such as RSMeans and converted to unit costs, typically \$/SF, and used to approximate future construction costs or replacement values. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The Current Replacement Value (CRV) is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude softcost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:

| Gross Area (SF): | 147,385 |
|--------------------|-------------|
| Year Built: | 1979 |
| Last Renovation: | 2014 |
| Replacement Value: | \$5,985,455 |
| Repair Cost: | \$0.00 |
| Total FCI: | 0.00 % |
| Total RSLI: | 81.02 % |
| FCA Score: | 100.00 |
| | |



Description:

The narrative for this site is included in the Executive Summary Description at the front of this report.

Attributes: This asset has no attributes.


Dashboard Summary

Function:Gross Area:147,385Year Built:1979Last Renovation:2014Repair Cost:\$0Replacement Value:\$5,985,455FCI:0.00 %RSLI%:81.02 %

No data found for this asset

No data found for this asset

No data found for this asset

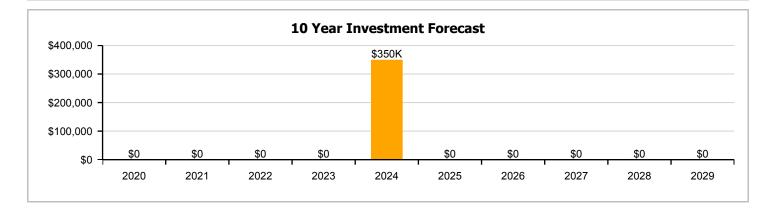

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT II classification Level 2. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

| UNIFORMAT Classification | RSLI % | FCI % | Current Repair Cost |
|---------------------------------|---------|--------|------------------------|
| G20 - Site Improvements | 79.11 % | 0.00 % | \$0.00 |
| G30 - Site Mechanical Utilities | 90.00 % | 0.00 % | \$0.00 |
| G40 - Site Electrical Utilities | 83.33 % | 0.00 % | \$0.00 |
| Totals: | 81.02 % | 0.00 % | \$0.00 |

Photo Album

The photo album consists of the various cardinal compass directions of the building..

1). South Point Arial View - Jan 21, 2020



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment)
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system as new construction.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

| System Code | System Description | Unit Price \$ | UoM | Qty | Life | Year Installed | Calc Next Renewal Year | Next Renewal Year | RSLI% | FCI% | RSL | eCR | Deficiency \$ | Replacement Value \$ |
|----------------|---------------------------------|---------------|------|---------|------|-------------------|---------------------------------|-------------------------|---------|--------|-----|-----|---------------|-------------------------|
| G2010 | Roadways | \$2.34 | | 147,385 | 35 | 2015 | 2050 | | 88.57 % | 0.00 % | 31 | | | \$344,881 |
| G2020 | Parking Lots | \$7.93 | S.F. | 147,385 | 35 | 2014 | 2049 | | 85.71 % | 0.00 % | 30 | | | \$1,168,763 |
| G2030 | Pedestrian Paving | \$2.29 | S.F. | 147,385 | 35 | 2014 | 2049 | | 85.71 % | 0.00 % | 30 | | | \$337,512 |
| G2040105 | Fence & Guardrails | \$1.14 | S.F. | 147,385 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$168,019 |
| G2040210 | Concrete Retaining Walls | \$52.57 | S.F. | 900 | 50 | 2014 | 2064 | | 90.00 % | 0.00 % | 45 | | | \$47,313 |
| G2040950 | Baseball Field | \$6.68 | S.F. | 147,385 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$984,532 |
| G2040950 | Covered Walkways | \$1.15 | S.F. | 147,385 | 25 | 2014 | 2039 | | 80.00 % | 0.00 % | 20 | | | \$169,493 |
| G2040950 | Football/Soccer Field | \$4.45 | S.F. | 147,385 | 20 | 2014 | 2034 | | 75.00 % | 0.00 % | 15 | | | \$655,863 |
| G2040950 | Track | \$1.86 | S.F. | 147,385 | 10 | 2014 | 2024 | | 50.00 % | 0.00 % | 5 | | | \$274,136 |
| G2050 | Landscaping | \$1.18 | S.F. | 147,385 | 25 | 2014 | 2039 | | 80.00 % | 0.00 % | 20 | | | \$173,914 |
| G3010 | Water Supply | \$1.09 | S.F. | 147,385 | 50 | 2014 | 2064 | | 90.00 % | 0.00 % | 45 | | | \$160,650 |
| G3020 | Sanitary Sewer | \$2.17 | S.F. | 147,385 | 50 | 2014 | 2064 | | 90.00 % | 0.00 % | 45 | | | \$319,825 |
| G3030 | Storm Sewer | \$1.24 | S.F. | 147,385 | 50 | 2014 | 2064 | | 90.00 % | 0.00 % | 45 | | | \$182,757 |
| G4010 | Electrical Distribution | \$2.54 | S.F. | 147,385 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$374,358 |
| G4020 | Site Lighting | \$2.96 | S.F. | 147,385 | 30 | 2014 | 2044 | | 83.33 % | 0.00 % | 25 | | | \$436,260 |
| G4030 | Site Communication and Security | \$1.27 | S.F. | 147,385 | 30 | 2014 | 2044 | _ | 83.33 % | 0.00 % | 25 | | | \$187,179 |
| | | | | | | | | Total | 81.02 % | | | | | \$5,985,455 |

System Notes

The facility description in the executive summary contains an overview of each system. The system notes listed below provide additional information on select systems found within the facility.

System: G2010 - Roadways







Note:

System: G2020 - Parking Lots







Note:

System: G2030 - Pedestrian Paving







Note:

System: G2040105 - Fence & Guardrails







Note:

System: G2040210 - Concrete Retaining Walls



Note:

System: G2040950 - Baseball Field







Note:

System: G2040950 - Covered Walkways







Note:

System: G2040950 - Football/Soccer Field





Note:

System: G2040950 - Track





Note:

System: G3010 - Water Supply







Note:


System: G3020 - Sanitary Sewer



Note:

System: G3030 - Storm Sewer



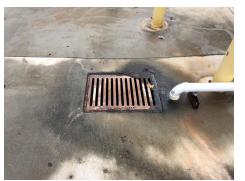

Note:

System: G4010 - Electrical Distribution







Note:

System: G4020 - Site Lighting







Note:

System: G4030 - Site Communication and Security







Note:

Renewal Schedule

eCOMET forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the System Listing table. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.


Inflation Rate: 3%

| System | Current Deficiencies | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | Total |
|---|-------------------------|------|------|------|------|-----------|------|------|------|------|------|-----------|
| Total: | | \$0 | \$0 | \$0 | \$0 | \$349,579 | \$0 | \$0 | \$0 | \$0 | \$0 | \$349,579 |
| G - Building Sitework | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G20 - Site Improvements | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2010 - Roadways | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2020 - Parking Lots | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2030 - Pedestrian Paving | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2040 - Site Development | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2040105 - Fence & Guardrails | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2040210 - Concrete Retaining Walls | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2040950 - Baseball Field | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2040950 - Covered Walkways | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2040950 - Football/Soccer Field | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G2040950 - Track | \$0 | \$0 | \$0 | \$0 | \$0 | \$349,579 | \$0 | \$0 | \$0 | \$0 | \$0 | \$349,579 |
| G2050 - Landscaping | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G30 - Site Mechanical Utilities | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G3010 - Water Supply | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G3020 - Sanitary Sewer | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G3030 - Storm Sewer | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G40 - Site Electrical Utilities | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G4010 - Electrical Distribution | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G4020 - Site Lighting | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |
| G4030 - Site Communication and Security | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 | \$0 |

^{*} Indicates non-renewable system

Forecasted Capital Renewal Requirement


The following chart shows the current building deficiencies and forecasted capital renewal (sustainment) requirements over the next ten years.

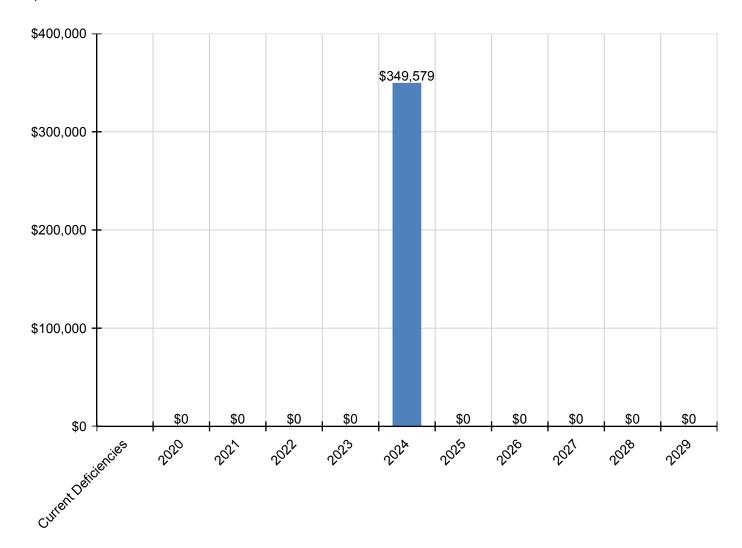

Condition Index Forecast by Investment Scenario

The chart below illustrates the effect of various investment levels on the building FCI for the next 10 years. The levels of investment shown below include:

- Current FCI: a variable investment amount based on renewing expired systems to maintain the current FCI for the building
- 2% Investment: an annual investment of 2% of the replacement value of the building, escalated for inflation
- 4% Investment: an annual investment of 4% of the replacement value of the building, escalated for inflation

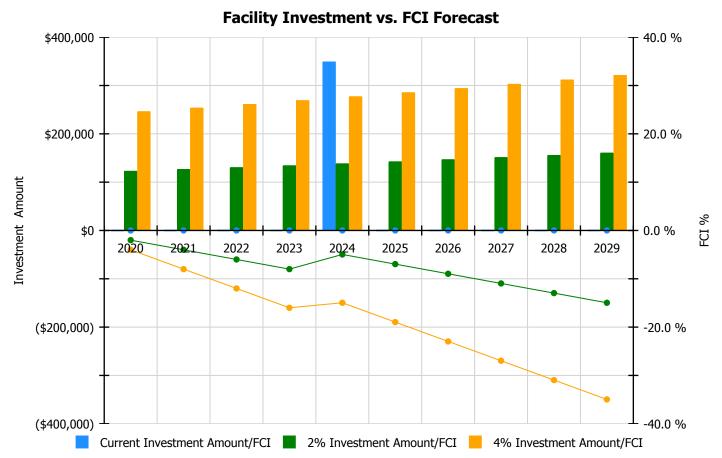

| | Investment Amount | 2% Investm | ent | 4% Investment | | | |
|--------|-------------------|----------------|----------|----------------|----------|--|--|
| Year | Current FCI - 0% | Amount | FCI | Amount | FCI | | |
| 2020 | \$0 | \$123,300.00 | -2.00 % | \$246,601.00 | -4.00 % | | |
| 2021 | \$0 | \$126,999.00 | -4.00 % | \$253,999.00 | -8.00 % | | |
| 2022 | \$0 | \$130,809.00 | -6.00 % | \$261,619.00 | -12.00 % | | |
| 2023 | \$0 | \$134,734.00 | -8.00 % | \$269,467.00 | -16.00 % | | |
| 2024 | \$349,579 | \$138,776.00 | -4.96 % | \$277,551.00 | -14.96 % | | |
| 2025 | \$0 | \$142,939.00 | -6.96 % | \$285,878.00 | -18.96 % | | |
| 2026 | \$0 | \$147,227.00 | -8.96 % | \$294,454.00 | -22.96 % | | |
| 2027 | \$0 | \$151,644.00 | -10.96 % | \$303,288.00 | -26.96 % | | |
| 2028 | \$0 | \$156,193.00 | -12.96 % | \$312,386.00 | -30.96 % | | |
| 2029 | \$0 | \$160,879.00 | -14.96 % | \$321,758.00 | -34.96 % | | |
| Total: | \$349,579 | \$1,413,500.00 | | \$2,827,001.00 | | | |

Deficiency Summary by System

Current deficiencies included assemblies that have reached or exceeded their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Useful Life'. The following chart lists all current deficiencies associated with this facility.

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

Deficiency By Priority Investment Table

The table below shows the current investment cost grouped by deficiency priority and building system.

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Glossary

Abandoned A facility owned by the city that is not occupied and not maintained. See Vacant.

Additional Cost Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs

that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET database at the owner's

discretion.

Assessment Visual survey of a facility to determine its condition. It involves looking at the age of systems,

reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or

equipment for functionality.

ASTM ASTM International (ASTM): Originally known as the American Society for Testing and Materials,

ASTM is an international standards organization that develops and publishes voluntary consensus

technical standards for a wide range of materials, products, systems, and services.

BOMA Building Owners Managers of America (BOMA): National organization of public and private facility

owners focused on building management tools and maintenance techniques. eCOMET®

reference: Building and component system effective economic life expectancies.

Building A fully enclosed and roofed structure that can be traversed internally without exiting to the

exterior.

Building Addition An area, space or component of a building added to a building after the original building's year

built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1987 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service

life.

Building Systems eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed

by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat /

MasterSpec system.

Calculated Next Renewal The year a system or building element would be expected to expire based solely on the date it

was installed and the expected useful lifetime for that kind of system.

Capital Renewal Capital renewal refers to the cyclical replacement of building systems or elements as they become

obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.

City Cost Index (CCI)

RS Means provides building system, equipment, and construction costs at a national level. The

City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all

of the associated costs for systems, deficiencies and inventory to the local value.

Condition Condition refers to the state of physical fitness or readiness of a facility system or system element

for its intended use.

Condition Budget The Condition Budget, also known as Condition Needs, represents the budgeted contractor

installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might

also be associated with the corrective actions due to packaging the work.

Condition Index (CI) %

The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).

Correction

Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.

Cost Model

A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.

Criteria

Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.

Current Period

The Current Period is the current year plus a user defined number of forward years.

Current Replacement

Value (CRV)

The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.

Deferred Maintenance

Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.

Deficiency

A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.

Deficiency Category

Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.

Deficiency Priority

Priority refers to a deficiency's urgency for repair as determined by the assessment team. Five typical industry priority settings were used for the assessment: Priority 1 – Currently Critical; Priority 2 – Potentially Critical; Priority 3 – Necessary/Not Yet Critical; Priority 4 – Recommended.

Distress

Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.

eCOMET®

Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

eCOMET® Cost Models

eCOMET cost models are derived from RS Means Square Foot Cost Data cost models and these models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility that meets local standards cost trends.

Element Elements are the major components that comprise building systems as defined by UNIFORMAT II.

Expected Life Also referred to as Useful Life. See Useful Life definition.

Facility A facility refers to site(s) building(s) or building addition(s) or combinations thereof that provide a

particular service.

Facility Attributes Customizable eCOMET fields to identify attributes specific to a facility. These fields are part of the

eCOMET database set-up with the owner.

Facility Condition A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for

planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet

the mission of the organization.

Facility Condition Index

Gen (Generate)

(FCI%)

FCI is an industry-standard measurement of a facility's condition that is the ratio of the cost to correct a facility's deficiencies to the Current Replacement Value of the facilities. The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.

Forecast Period The Forecast Period refers to a user defined number of years forward of the Current Period.

generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish

The Cost Model has a Gen box for each system line item. By checking the box, eCOMET will

the entire facility than re-new those systems.

Gross Square Feet (GSF) The size of the enclosed floor space of a building in square feet measured to the outside face of

the enclosing wall.

Life Cycle Life cycle refers to the period of time that a building or site system or element can be expected to

adequately serve its intended function. Parsons assigns expected life cycles to all building systems

based on Building Operators and Managers of America (BOMA) recommended life cycles,

manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction

estimating and costs.

Next Renewal Next Renewal refers to a manually-adjusted expected useful life of a system or element based on

on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately

reflect current conditions.

Order of Magnitude Order of Magnitude refers to a rough approximation made with a degree of knowledge and

confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost

values.

Remaining Service Life

(RSL)

RSL is the number of years service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the 'Calculated Next Renewal'

date or the 'Next Renewal' date whichever one is the later date.

Remaining Service Life Index (RSLI)

The Remaining Service Life Index (RSLI), also known as the Condition Index (CI), is calculated as the sum of a renewable system's or component's Remaining Service Life (RSL) Value divided by the sum of a system's or component's Replacement Value (both values exclude softcost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining service life).

Remaining Service Life

Value

Remaining Service Life Value, also known as the RSL Weight, is a calculated value used to determine the RSLI and is equal to the system Value (Unit Cost * Qty) * RSL (not displayed).

Renewal Factors

Renewal factors represent the difference in cost of renovating or replacing an existing system, rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty costs, Parsons typically assigns a renewal factor of 110%.

Renewal Schedule

A timeline that provides the items that need repair the year in which the repair is needed and the estimated price of the renewal.

Repair Cost

Repair cost is the sum of all the deficiencies associated with a building or multiple buildings/facilities. It will include any applied soft costs or City Cost Indexes.

Replacement Value

See Current Replacement Value.

Site

A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land improvements needed to support a facility.

Soft Costs

Soft Costs are a construction industry term that refers to expense items that are not considered direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.

Sustainability

Sustainability refers to the collection of policies and strategies that meet society's present needs without compromising the ability of future generations to meet their own needs.

System

System refers to building and related site work elements as described by ASTM Uniformat II Classification for Building Elements (E1557-97) a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design specification construction method or materials used. See also Uniformat II.

System Generated Deficiency eCOMET automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.

UNIFORMAT

ASTM UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish them. These elements are often referred to as systems or assemblies.

Unit Price

The Unit Price (Raw) x the Additional Cost Template percentage.

Unit Price (Raw)

The actual \$/sq. ft. cost being used for the building and systems. It will include adjustments for the City Cost Index applied to the facility.

eCOMET - Revised Nov 11, 2020 Page 93 of 94

School Assessment Report - Bunche Middle School

Useful Life Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element

is expected to perform as intended. Useful life is generally provided by manufacturers of materials,

systems and elements through their literature, testing and experience. Useful Lives in the database are derived from the Building Owners and Managers (BOMA) organization's guidelines,

RSMeans cost data, and from client- defined historical experience.

Vacant refers to a facility that is not occupied but is a maintained facility. See Abandoned.

Year Built The year that a building or addition was originally built based on substantial completion or

occupancy.

minimum of 70% of the system's Current Replacement Value (CRV) was replaced.

BASYS

Building Assessment System

Project: APS Assessments 2019

Suitability Report - Full

Site: Bunche MS

Project #: 12382 County: Atlanta Public Schools Site #: 0180

Grade Config: 6-8 Site Type: Middle Site Size: 42.00

Region: 761

| uitability | Rating | Score | Possible Score | Percent Score |
|------------------------------|--------|-------|-------------------|------------------|
| uitability - MS | | | | |
| Learning Environment | | | | |
| Learning Style Variety | Good | 4.00 | 5.00 | 80.0 |
| Interior Environment | Excel | 2.00 | 2.00 | 100. |
| Exterior Environment | Good | 1.20 | 1.50 | 80. |
| General Classrooms | | | | |
| Environment | Excel | 3.90 | 3.90 | 100. |
| Size | Excel | 9.75 | 9.75 | 100. |
| Location | Excel | 2.93 | 2.93 | 100. |
| Storage/Fixed Equip | Good | 2.34 | 2.93 | 80. |
| Self-Contained Special Ed | | | | |
| Environment | Excel | 0.55 | 0.55 | 100 |
| Size | Good | 1.09 | 1.36 | 80. |
| Location | Good | 0.33 | 0.41 | 80 |
| Storage/Fixed Equip | Excel | 0.41 | 0.41 | 100 |
| Instructional Resource Rooms | | | | |
| Environment | Good | 0.66 | 0.82 | 80 |
| Size | Good | 1.64 | 2.05 | 80 |
| Location | Excel | 0.61 | 0.61 | 100 |
| Storage/Fixed Equip | Fair | 0.40 | 0.61 | 65 |
| Science | | | | |
| Environment | Excel | 0.95 | 0.95 | 100 |
| Size | Excel | 2.39 | 2.39 | 100 |
| Location | Excel | 0.72 | 0.72 | 100 |
| Storage/Fixed Equip | Good | 0.57 | 0.72 | 80 |
| Music | 333 | | | |
| Environment | Excel | 0.74 | 0.74 | 100 |
| Size | Excel | 1.84 | 1.84 | 100 |
| Location | Excel | 0.55 | 0.55 | 100 |
| Storage/Fixed Equip | Good | 0.44 | 0.55 | 80 |
| Art | 333 | | | |
| Environment | Excel | 0.65 | 0.65 | 100 |
| Size | Good | 1.29 | 1.61 | 80. |
| Location | Excel | 0.48 | 0.48 | 100 |
| Storage/Fixed Equip | Excel | 0.48 | 0.48 | 100 |
| Career Tech Ed | | | | |
| Environment | Excel | 1.35 | 1.35 | 100 |

4/7/2020 12:48:19PM Page 1 of 3

Project #: 12382

County: Atlanta Public Schools

Site #: 0180

Project: APS Assessments 2019

Region: 761

Site: Bunche MS

Grade Config: 6-8 Site Type: Middle

Site Size: 42.00

| iitability | Rating | Score | Possible Score | Percent Score |
|----------------------------|--------|-------|-------------------|------------------|
| Size | Good | 2.70 | 3.37 | 80.00 |
| Location | Excel | 1.01 | 1.01 | 100.00 |
| Storage/Fixed Equip | Excel | 1.01 | 1.01 | 100.00 |
| Computer Labs | Excel | | | |
| Environment | Excel | 0.30 | 0.30 | 100.00 |
| Size | Excel | 0.75 | 0.75 | 100.00 |
| Location | Good | 0.18 | 0.23 | 80.00 |
| Storage/Fixed Equip | Excel | 0.23 | 0.23 | 100.00 |
| P.E. | 2,001 | | | |
| Environment | Excel | 2.40 | 2.40 | 100.00 |
| Size | Excel | 6.00 | 6.00 | 100.00 |
| Location | Excel | 1.80 | 1.80 | 100.00 |
| Storage/Fixed Equip | Excel | 1.80 | 1.80 | 100.00 |
| Performing Arts | | | | |
| Environment | Excel | 0.42 | 0.42 | 100.00 |
| Size | Excel | 1.05 | 1.05 | 100.00 |
| Location | Excel | 0.31 | 0.31 | 100.00 |
| Storage/Fixed Equip | Excel | 0.31 | 0.31 | 100.00 |
| Media Center | | | | |
| Environment | Excel | 0.93 | 0.93 | 100.00 |
| Size | Fair | 1.51 | 2.32 | 65.00 |
| Location | Excel | 0.70 | 0.70 | 100.00 |
| Storage/Fixed Equip | Excel | 0.70 | 0.70 | 100.00 |
| Restrooms (Student) | Excel | 0.93 | 0.93 | 100.00 |
| Administration | Excel | 2.10 | 2.10 | 100.00 |
| Counseling | Excel | 0.42 | 0.42 | 100.00 |
| Clinic | Excel | 0.34 | 0.34 | 100.00 |
| Staff WkRm/Toilets | Excel | 0.91 | 0.91 | 100.00 |
| Cafeteria | Fair | 2.60 | 4.00 | 65.00 |
| Food Service and Prep | Excel | 5.72 | 5.72 | 100.00 |
| Custodial and Maintenance | Excel | 0.50 | 0.50 | 100.00 |
| Outside | | | | |
| Vehicular Traffic | Excel | 4.00 | 4.00 | 100.00 |
| Pedestrian Traffic | Good | 0.35 | 0.43 | 80.00 |
| Parking | Excel | 0.86 | 0.86 | 100.00 |
| Athletic Courts and Fields | Excel | 1.05 | 1.05 | 100.00 |
| Safety and Security | | | | |
| Fencing | Excel | 0.78 | 0.78 | 100.00 |
| Signage & Way Finding | Poor | 0.50 | 1.00 | 50.00 |
| Ease of Supervision | Excel | 3.00 | 3.00 | 100.00 |
| Controlled Entrances | Excel | 0.50 | 0.50 | 100.00 |
| I For Site: | | 92.88 | 100.00 | 92.88 |

Comments

4/7/2020 12:48:19PM Page 2 of 3 Project #: 12382 County: Atlanta Public Schools Site #: 0180

Project: APS Assessments 2019 Region: 761 Site: Bunche MS

Grade Config: 6-8 Site Type: Middle Site Size: 42.00

Suitability Rating Rating Possible Percent Score Score Score

Suitability - MS

Bunche Middle School hosts the International Baccalaureate Middle Years Programme as well as the regional center for autistic students. It also offers a CTAE program in video technology. This school serves students in grades 6-8. The building was first built in 1979 with an addition and renovations completed in 2014.

Suitability - MS->Instructional Resource Rooms-->Storage/Fixed Equip

There is a resource room in each grade level wing. Each of these rooms is smaller than the other classrooms, and have less storage and access to storage.

Suitability - MS->Career Tech Ed-->Size

The business lab, used for video production, is 62% of the standard. The health lab meets the standard.

Suitability - MS->P.E.

The gym area includes a dance room.

Suitability - MS->P.E.-->Size

The gym in this school meets the standard when the bleachers are folded and out of use.

Suitability - MS->Media Center-->Size

The media center is 78% of the standard.

Suitability - MS->Cafeteria

The cafeteria is very loud, with tile floors and concrete block walls. This space opens to the parking lot, allowing access to the school.

Suitability - MS->Safety and Security-->Signage & Way Finding

Visitor parking and security signs are missing. Internal signs to direct students and visitors are not available. Signage on classroom doors is not permanent.

4/7/2020 12:48:19PM Page 3 of 3